INSTALLATION INSTRUCTIONS

I/S SLENDERFORM CEILING LUMINAIRE

PHILIPS GARDCO

A819498/443561055020 REV B SHEET 1 0F 2

© 2016 Philips Lighting Holding B.V. All rights reserved.


IMPORTANT: Read all instructions before performing any work. Make sure ALL POWER is OFF PRIOR to installing luminaires.

CAUTION: Philips Gardco is not responsible for failure of mounting components supplied by others. Proper care should be exercised in mounting component selection to insure adequate luminaire support, given luminaire weight, vibration potential and thermal conditions present in the application. If luminaires are supported solely by screws into a composite j-box, additional support directly to structure is recommended. Failure to properly support the luminaire may cause damage or injury, for which Philips Gardco is not responsible.

Mounting Plate Installation


Mounting plate must be positioned parallel or perpendicular to driving lane.

- 1. Remove mounting plate from luminaire by backing out the #8-32 set screw about 1 inch. See Figure 1. Slide mounting plate toward the set screw side and lift up until removed. Remove gasket and cover plate from mounting plate by unscrewing the 2 wing nuts. See Figure 2.
- 2. Install mounting plate to junction box in one of the following manners;
- **a) For Damp Location Usage:** Secure mounting plate to 4" octagonal metal junction box using (2) #8 screws (by others) per Fig. 3.
- **b) For Wet Location Usage:** Secure mounting plate to weather proof cast metal junction box (by others). Seal between the mouth of cast box and mounting plate with RTV silicone sealant (by others) or equivalent to prevent water entry.

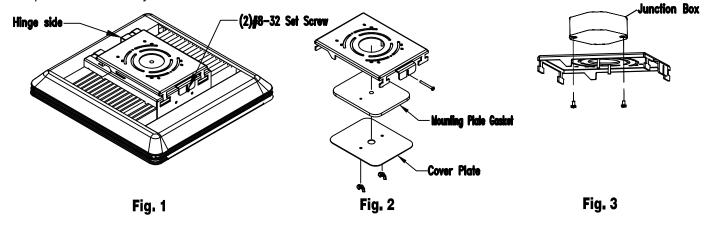

Luminaire Installation

- 1. Hook hinge side of luminaire mounting bracket to mounting plate and pull forward, allowing the unit to hinge downward as shown in Figure. 4.
- 2. Pull luminaire wire leads through mounting plate gasket and cover plate. Connect respective line, common and ground supply leads with wire connectors. Push wires and splices into junction box. Attach mounting plate gasket and cover plate to mounting plate with the 2 wing nuts previously removed.
- 3. Hinge luminaire to leveled position, making sure the front 2 tabs of the mounting plate engage the mounting bracket and the set screw is in the plate slot. Secure luminaire in position by tightening the #8-32 set screw.

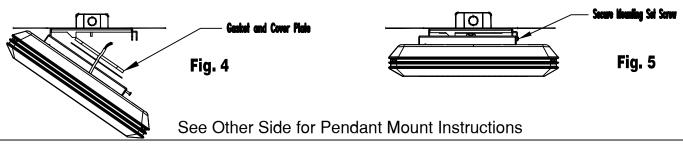

PHILIPS

INSTALLATION INSTRUCTIONS

I/S SLENDERFORM CEILING LUMINAIRE

PHILIPS GARDCO

A819498/443561055020 REV B SHEET 2 0F 2 © 2016 Philips Lighting Holding B.V. All rights reserved.

IMPORTANT: Read all instructions before performing any work. Make sure ALL POWER is OFF PRIOR to installing luminaires.

CAUTION: Philips Gardco is not responsible for failure of mounting components supplied by others. Proper care should be exercised in mounting component selection to insure adequate luminaire support, given luminaire weight, vibration potential and thermal conditions present in the application. If luminaires are supported solely by screws into a composite j-box, additional support directly to structure is recommended. Failure to properly support the luminaire may cause damage or injury, for which Philips Gardco is not responsible.

Rigid Pendant Stem Mount Installation

- 1. Install junction box (see mounting plate installation for appropriate type) to steel conduit per Figure 5.
- 2. Install mounting plate and luminaire as described on other side of this sheet.





Fig. 5

Non-Rigid Pendant Stem Mount Installation

- 1. Install clamping nut (supplied) to 3/4" IPS steel conduit (by others). Sealing feature to be toward open end of conduit.(Fig. 6)
- 2. Attach junction box to pendant stem and tighten clamping nut.
- 3. Attach mounting plate to cast junction box with (4) #8-32 screws.
- 4. Proceed with luminaire installation as described on other side of this sheet.

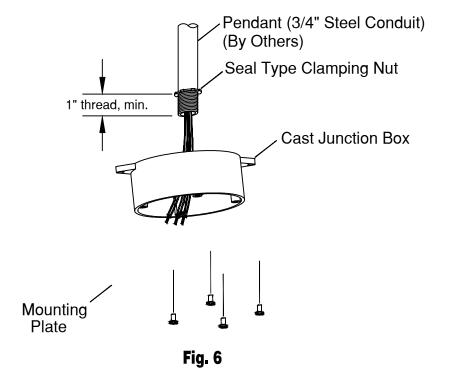

PHILIPS

Philips Lighting North America Corporation 200 Franklin Square Drive, Somerset, NJ 08873, USA Philips Lighting Canada Ltd. 281 Hillmount Road, Markham ON, Canada L6C 2S3